

Manhole Inspection Summary

Manhole # S39G__011MH

Printed On: 1/29/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39G** Node: **011** Status: **Found**

Insp Date: **7/14/08 9:31 AM**

Incomplete Comments

Crew: **sac**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **115 Albemarle St**

Cross Street: **Granby ST**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **8.5** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **13** Missing: **0** ☒ **Corroded**

Surcharge

☒ **Evidence Of Surcharge**

Depth: **16.** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S39G__011MH

Printed On: 1/29/2009

Page 2 of 4

Location View



Top View



Defect 3



evidence of surcharge

Defect 2



deteriorated, loose bricks, frame adjustment

Defect 1



steps

Manhole Inspection Summary

Manhole # S39G__011MH

Printed On: 1/29/2009

Page 3 of 4


27 in. Circular Gravity Sewer
Drop In @ 12 OClock

12 O'Clock Outflow

Pipe Out @ 12 OClock



the invert vaules are in 6 o clock connectin
because program would not except a drop at
12

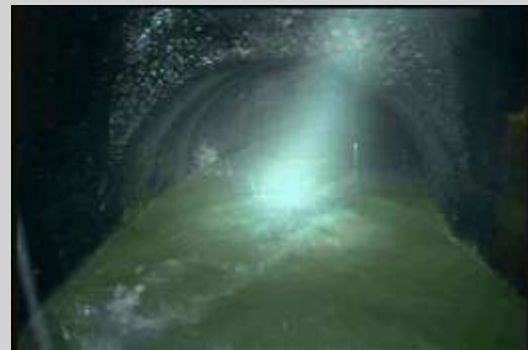

Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 10.47 (ft.) Flow Characteristics: Fast

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Manhole

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 OClock

6 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 17.00 (ft.) Flow Characteristics: Fast

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: Outside Direct

Angled: Reading: 0.00 (ft.)

Inv Depth: 18.84 (ft.)

Drop Condition: Open

Connects To: Manhole

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S39G__011MH

Printed On: 1/29/2009

Page 4 of 4

15 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.81** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection